

#PIC4917: DTC B0081 5A In History - keywords air bag sym5a bag current history pps sdm - (Jul 9, 2008)

Subject: DTC B0081 5A in History

Models: 2008-2009 Pontiac G8



The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern:

You may see DTC B0081 5A in history. This DTC is caused by an incorrect message between SDM and PPS, if during start-up, the IGN, is in accessory mode for an extended period of time before turning to run.

Recommendation/Instructions:

DO NOT replace parts if this DTC B0081 5A is in history. Check for DTC's with the IGN in RUN. If B0081 5A is in history, clear the DTC and check for the DTC with the IGN in RUN. The DTC should clear.

If the DTC B0081 5A is current while IGN in RUN, please follow the diagnostics in SI.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a ""do-it-yourselfer"". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT
VOLUNTARY
TECHNICIAN
CERTIFICATION