
Document ID: 1982204 Page 1 of 2

2009 Holden VE Sedan | VE, WM, Caprice, Statesman, Lumina, Omega, VXR8, Sportwagon Service Manual |

Body Hardware and Trim | Instrument Panel and Console Trim | Repair Instructions | Document ID: 1982204

Instrument Panel Insulator Panel Replacement - Right Side (RHD)

Removal Procedure

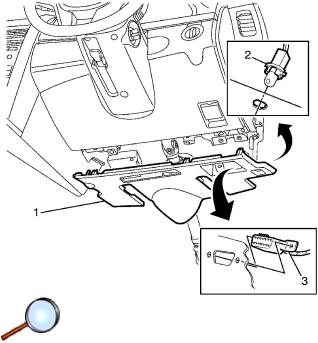


- 1. Remove the diagnostic plug (3) from the I/P lower trim plate assembly (1).
- 2. Grasp the I/P lower trim plate assembly (1) and carefully pull downward to disengage the retaining clips.
- 3. Disconnect the courtesy lamp socket assembly (2) from the right lower trim plate by turning the socket counterclockwise.
- 4. Remove the I/P lower trim plate assembly (1).

Installation Procedure

© 2011 General Motors Corporation. All rights reserved.

Document ID: 1982204 Page 2 of 2

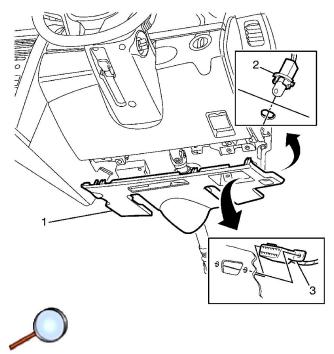

- 1. Connect the courtesy lamp socket assembly (2) to the I/P lower trim plate assembly (1).
- 2. Install the diagnostic plug (3) to the I/P lower trim plate assembly (1).
- 3. Align the I/P lower trim plate assembly (1) to the I/P.
- 4. Install the I/P lower trim plate assembly (1) to the I/P by pushing in the area of the retaining clips (2).
- 5. Ensure all clips are located correctly.